


# 產品尺寸圖 (DIMENSION)

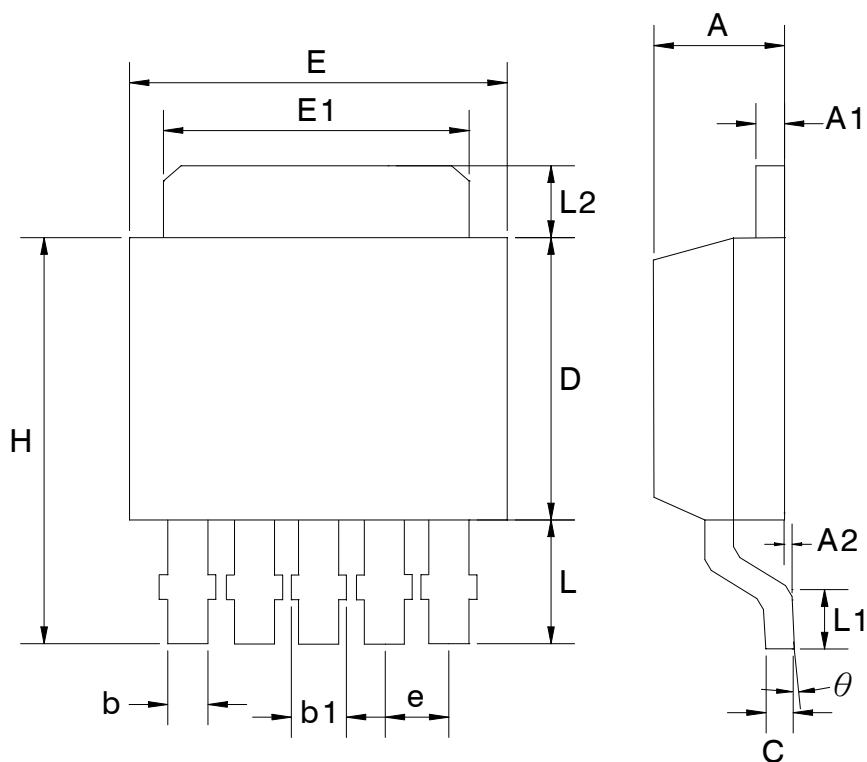

Symbol	Dimensions In Millimeters			Dimensions in Inches		
	Min	Nom	Max	Min	Nom	Max
A	2.18	-	2.38	0.086	-	0.094
A1	0.45	-	0.58	0.018	-	0.023
A2	0.00	-	0.13	0.000	-	0.005
b	0.46	-	0.64	0.018	-	0.025
b1	0.61	-	0.79	0.024	-	0.031
C	0.45	-	0.60	0.018	-	0.024
D	5.36	-	5.61	0.211	-	0.221
E	6.35	-	6.73	0.250	-	0.265
E1	5.21	-	5.46	0.205	-	0.215
e	1.27 BSC			0.050 BSC		
H	9.40	-	10.41	0.370	-	0.410
L	2.20	-	2.80	0.087	-	0.110
L1	1.40	-	1.78	0.055	-	0.070
L2	1.52	-	2.03	0.060	-	0.080
θ	0°	-	8°	0°	-	8°

Note : QC. Inspection Range : A,A1,A2,b,b1,C,D,E,E1,H

PACKAGE	TO-252-5	
DRAWING	DIM-TO252-5-0505-B	
SIGNATURE	製圖	莊立德
	審核	王啓任
	核准	許敏龍